

# Release Notes - Drives\_CFW : CFW500

## VERSION NUMBER

3.63

## RELEASE DATE

## DETAILS

Deviations Corrected:

-IP66 inverters can present the fault F0179 (Fan lowspeed). The cause for this fault is a functional deviation in firmware versions starting with the V3.52 and it is linked to the option 6 (Control RUN+60 s) of the parameter P0352 (Heatsink fan configuration). Only inverters with fan speed feedback are affected (serial number 1061266911). The new firmware version

-For 24A 200V models, the factory setting of the parameter P0136 (Manual torque boost) was too high and could cause current too high during start and keep the inverter in current limitation.

## VERSION NUMBER

V3.61

## RELEASE DATE

## DETAILS

Firmware release at the time the CFW500, AC Drive was launched.